## National Transportation Safety Board FACTUAL REPORT AVIATION

NTSB ID: DCA05MA037 Aircraft Registration Number: N500AT

Occurrence Date: 02/16/2005 Most Critical Injury: Fatal

Occurrence Type: Accident Investigated By: NTSB

Location/Time

Nearest City/Place	State	Zip Code	Local Time	Time Zone			
Pueblo	СО		0913	MST			
Airport Proximity: Off Airport/Airstrip	Distance From Landing Facility: 4						

Aircraft Information Summary

All of the fill of									
Aircraft Manufacturer	Model/Series	Type of Aircraft							
Cessna	560	Airplane							

Revenue Sightseeing Flight:

## Air Medical Transport Flight:

## Narrative

Brief narrative statement of facts, conditions and circumstances pertinent to the accident/incident:

\*\*\* Note: NTSB investigators traveled in support of this investigation and used data obtained from various sources to prepare this aircraft accident report. \*\*\*

The Safety Board's full report is available at http://www.ntsb.gov/publictn/publictn.htm. The Aircraft Accident Report number is NTSB/AAR-07/02.

On February 16, 2005, about 0913 mountain standard time, a Cessna Citation 560, N500AT, operated by Martinair, Inc., for Circuit City Stores, Inc., crashed about 4 nautical miles east of Pueblo Memorial Airport (PUB), Pueblo, Colorado, while on an instrument landing system (ILS) approach to runway 26R. The two pilots and six passengers on board were killed, and the airplane was destroyed by impact forces and postcrash fire. The flight was operating under the provisions of 14 Code of Federal Regulations Part 91 on an instrument flight rules flight plan. Instrument meteorological conditions prevailed at the time of the accident.

The accident flight and another Circuit City Stores Cessna 560 (N500FK, referred to in this report as the "sister ship") were scheduled to transport Circuit City Stores employees from Richmond International Airport, Richmond, Virginia, to John Wayne Airport, Santa Ana, California, with scheduled fuel stops at Columbia Regional Airport (COU), Columbia, Missouri, and PUB. The accident flight departed Richmond about 0600 eastern standard time. The flight arrived at COU about 0736 central standard time and departed for PUB about 30 minutes later.

At 0847:48, while descending through about flight level 370, the cockpit voice recorder (CVR) recorded the Denver Air Route Traffic Control Center instructing the flight crew to descend to and maintain 13,000 feet. About 0851, the CVR recorded the flight crew start discussing the icing conditions. Specifically, at 0850:40, the captain stated, "I'm gonna heat 'em up." About 4 minutes later, the captain stated that he turned the windshield heat on, and he then asked the first officer to let him know if he saw any ice on the wing. The first officer replied that he saw ice "building a little bit right on the [wing] leading edge...it's not the real white ice like we had yesterday. It's more of a grayish." The first officer then stated, "there's a real thin line back there." About 2 minutes later, the captain stated that it did not look like the airplane had accumulated any more ice.

At 0858:20, as the airplane was descending through about 18,000 feet, the first officer suggested that the captain cycle the deice boots. After cycling the deice boots, the captain stated, "might've gotten rid of a little but not much." At 0859:29, the first officer stated that the Vref was 96 knots. About 3 1/2 minutes later, the captain told the first officer to "leave the heats on," and the first officer replied, "okay. Got everything nice and warmed up."

At 0905:50, the first officer contacted PUB approach control and stated, "Pueblo approach...thirteen thousand with [automatic terminal information service] Juliet." The PUB local controller instructed

## National Transportation Safety Board FACTUAL REPORT

NTSB ID: DCA05MA037

Occurrence Date: 02/16/2005

Occurrence Type: Accident

Narrative (Continued)

the flight crew to fly heading 240° for the ILS runway 26R final approach course and to descend to and maintain 7,000 feet. The first officer asked, "did you say two six right now?" The controller confirmed that runway 26R was in use. The controller also reported that a regional jet was in a holding pattern over PUB at 9,000 feet and asked the pilots to report when they had the airplane in sight. The first officer then told the captain that the controller had changed the landing runway from 8L to 26R.

At 0907:36, the PUB local controller asked the pilots if they had the airplane in sight, and the first officer stated that he did not. The controller replied, "give me a best rate of descent through niner thousand or maintain one zero thousand. I'll just turn you." The first officer stated that they would descend to 7,000 feet. At 0908:25, the first officer reported to the controller that the flight was in IMC at an altitude of about 9,400 feet. The controller then instructed the flight to turn left to a heading of 170°. At 0908:55, the controller instructed the flight crew to turn right to a heading of 290° to intercept the localizer inbound. He then instructed the flight crew to maintain 7,000 feet and cleared the flight for the approach.

At 0909:19, the first officer stated, "you got a little different ice on there now. It's clear." The captain replied, "yeah," and he then instructed the first officer to "open up those valves all the way." The first officer replied, "all right, will do." At 0909:41, the PUB local controller provided the flight crew with the current weather, which indicated the following: cloud ceilings broken at 900 feet and overcast at 1,400 feet, visibility 6 statute miles in mist, temperature ?3° Celsius (C), dew point -4° C, wind 070° at 7 knots, and altimeter 30.16 inches of mercury.

At 0910:22, the first officer stated, "ignition is on with the anti-ice, now it's on for sure. Glideslope is alive." At 0911:10, the captain stated, "[landing] gear's down." The PUB local controller cleared the flight to land on runway 26R and instructed the flight crew to maintain its present heading and altitude until established on the ILS localizer. At 0911:45, the CVR recorded the captain stating, "speed brakes coming back out." The first officer replied, "okay...there's your glideslope intercept." The captain then called for full flaps. The first officer responded, "full flaps, here we go...full selected and indicated." At 0912:00, the first officer briefed the missed approach. Four seconds later, he stated, "you are plus twenty five," and the captain replied, "slowing." At 0912:37, the first officer stated, "I don't know if you want to run your ice a little bit. You got the Vref there."

Airplane performance calculations show that, about 0912:40, immediately after passing through about 6,100 feet, the airplane experienced an upset and the onset of a large roll to the left concurrent with a rapid decrease in pitch. The CVR recorded a short tone concurrent with the beginning of the upset. The frequency and the duration of the tone were consistent with the autopilot disconnect horn. At 0912:46, the CVR recorded the enhanced ground proximity warning system "bank angle" aural warning alert. The last radar return was received at 0912:54 while the airplane was at an altitude of about 4,922 feet. One second later, the CVR stopped recording. According to the Federal Aviation Administration air traffic control transcript, at 0912:57, the PUB local controller issued an altitude alert to the accident flight, stating, "zero alpha tango altitude alert altitude indicates four thousand niner hundred over."

National Transportation Safety Board
FACTUAL REPORT

NTSB ID: DCA05MA037

Occurrence Date: 02/16/2005

AVIATION		Occurrence Type: Accident									
Landing Facility/Approach Information											
Airport Name	rport ID:	Airport E	evation	Run	way Used	Runwa	y Lengt	h F	Runway Width		
Pueblo Memorial Airport	PUB	4726	Ft. MSL	Ft. MSL 26R 104							
Runway Surface Type: Asphalt											
Runway Surface Condition:											
Approach/Arrival Flown: ILS											
VFR Approach/Landing:											
Aircraft Information											
Aircraft Manufacturer Cessna			Model/ 560	/Series					Serial 560-0	Number 0146	
Airworthiness Certificate(s): Norm	al		•						•		
Landing Gear Type: Retractable	- Tricycle										
Amateur Built Acft?	Certified Max Gross Wt.				19000 LBS Number			er of Engines: 2			
Engine Type: Turbo Fan	Engine Manufacturer: Model/Series: Pratt & Whitney Canada JT15D-5A								Rated Power: 2900 LBS		
- Aircraft Inspection Information											
Type of Last Inspection		D	Date of Last Inspection Ti			Time Si	nce Last Insp		Airframe	e Total Time	
Continuous Airworthiness			12/2004 54.				54.5 Ho	.5 Hours 3657.5			
- Emergency Locator Transmitter (	ELT) Information										
ELT Installed?/Type Yes /		E	LT Opera	ted? Yes		ELT Aid	ded in Locatin	g Accide	ent Site?	)	
Owner/Operator Information											
Registered Aircraft Owner			Street A	Address							
Circuit City Stores, Inc			City							State VA	Zip Code
	Street Address										
Operator of Aircraft										_	
Circuit City Stores, Inc	City State Zip Co							Zip Code			
Operator Does Business As:  Operator Designator Code:											
- Type of U.S. Certificate(s) Held: 1	None										
Air Carrier Operating Certificate(s)	:										
Operating Certificate: Operator Certificate:											
Regulation Flight Conducted Under: Part 91: General Aviation											
Type of Flight Operation Conducted	: Executive/Corp	orate									
	J	FACTUA	L REPO	RT - AVI	ATION						Page 2

National Transportation Safety Board
FACTUAL REPORT
AVIATION

NTSB ID: DCA05MA037

Occurrence Date: 02/16/2005

AVIATION				Occurrence Type: Accident										
First Pilot Information														
Name City State Date of Birth Age											Age			
On File		·								53				
Sex: M Seat Occupied: Left Occupational Pilot? Certificate Number:												l		
Certificate(s): Airline Transport; Flight Instructor; Commercial														
Airplane Rating(s): Multi-engine Land; Single-engine Land														
Rotorcraft/Glider/LTA:														
Instrument	Rating(s): Airpl	ane												
Instructor F	Rating(s): Airpl	ane Single-	engine											
Current Bie	nnial Flight Revie	w? 11/200	4											
Medical Ce	rt.: Class 1	Medica	al Cert. Status	: With Wa	ivers/Limita	ations			Date o	of Last I	Medical I	Exam: C	2/2005	
- Flight Tim	ne Matrix	All A/C	This Make and Model	Airplane Single Engine	Airplane Mult-Engine	Ni	Night Instrum		Instrument Simulated		Rotorcraft		Glider	Lighter Than Air
Total Time		8577	2735											
Pilot In Cor	nmand(PIC)	4452	1500											
Instructor														
Instruction	Received													
Last 90 Day	ys	113										_		
Last 30 Day		39										_		
Last 24 Ho		3	<u></u>								<u> </u>			
Seatbelt Us	sed?	Shou	ılder Harness	Used?			Toxicology Performed? Yes Second Pilot? Yes						S	
Flight Pla	n/Itinerary													
	ht Plan Filed: IF	R												
Departure F	Point						State	State Airport Identifier Departure Time			me	Time Zone		
Columbia											0800	0800		CST
Destination	Destination State Airport Identifier													
PUEBLO							со РИВ							
Type of Clearance: IFR														
Type of Airspace:														
Weather Information														
Source of Wx Information:														
Commercial Weather Service														
				FACTUAI	L REPORT	- AVI	ATION							Page 3

National Transportation Safety Board
FACTUAL REPORT

NTSB ID: DCA05MA037

Occurrence Date: 02/16/2005

	AVIATION			Occurrence Type: Accident										
Weather Information														
WOF ID	Observation Time	Time Zone	V	NOF Elevati	on	WOF D	istance Fr	om Accid	dent Site		Direction F	Pirection From Accident Site		
KPUB	0853	MST		4725 Ft.	MSL				3 NM		270 Deg. Mag.			
Sky/Lowes	et Cloud Condition:						Ft. A	AGL	Condition of Light: Day					
Lowest Ce	iling: Broken			900 Ft.	AGL	Visib	ility:	8	SM Altimeter: 30.16			"Hg		
Temperatu	ıre: -3 °C [	Dew Point:		-5 °C Weather Conditions at Acciden				ccident S	Site: Instrum	ent (	Conditions			
Wind Direc	ction: 60	Wind Sp	eed:			Wind	d Gusts:							
Visibility (F	RVR): Ft.	Visibility	(RVV	)	SM									
Precip and	l/or Obscuration:													
Accident	Information													
Aircraft Da	mage: Destroyed			Aircraft Fire: Ground					Aircraft Exp	losio	n None			
- Injury Su	mmary Matrix	Fatal	Seriou	us Mino	r	None	TOTAL							
First Pi	lot	1						1						
Second	d Pilot	1						1						
Studen	t Pilot							7						
Flight I	nstructor							7						
Check	Pilot							7						
Flight E	Engineer							7						
Cabin A	Attendants							7						
Other C	Crew							7						
Passer	ngers	6						6						
- TOTAL A	ABOARD -	8						8						
Other C	Ground							Ì						
- GRANE	O TOTAL -	8						8						
		•		·	•			•						

National Transportation Safety Board

NTSB ID: DCA05MA037

FACTUAL REPORT	Occurrence Date: 02/16/2005									
AVIATION	Occurrence Type: Accident									
Administrative Information	•									
Investigator-In-Charge (IIC)										
Frank Hilldrup										
Additional Persons Participating in This Accident/Incident Investigation:										